

ebm-papst Mulfingen GmbH & Co. KG

Bachmühle 2 · D-74673 Mulfingen

Phone +49 7938 81-0

Fax +49 7938 81-110

info1@de.ebmpapst.comwww.ebmpapst.com

Limited partnership · Headquarters Mulfingen

County court Stuttgart · HRA 590344

General partner Elektrobau Mulfingen GmbH · Headquarters Mulfingen

County court Stuttgart · HRB 590142

Nominal data

Type	W2E200-CI38-01		
Motor	M2E068-BF		
Phase		1~	1~
Nominal voltage	VAC	230	230
Frequency	Hz	50	60
Type of data definition		fa	fa
Valid for approval / standard		CE	CE
Speed	min ⁻¹	2600	2900
Power input	W	64	78
Current draw	A	0.3	0.34
Motor capacitor	µF	1.5	1.5
Capacitor voltage	VDB	450	450
Max. back pressure	Pa	150	150
Max. ambient temperature	°C	65	65
Starting current	A	0.55	0.54

ml = max. load · me = max. efficiency · fa = running at free air · cs = customer specs · cu = customer unit
Subject to alterations




Technical features

Mass	2.38 kg
Size	200 mm
Surface of rotor	Coated in black
Material of blades	Sheet steel, coated in black
Material of wall ring	Sheet steel, pre-galvanized and coated in black plastic
Material of guard grille	Steel, phosphated and coated in black plastic
Number of blades	9
Direction of air flow	"A"
Direction of rotation	Counter-clockwise, seen on rotor
Type of protection	IP 44
Insulation class	"B"
Humidity class	F1-2
Max. permissible ambient motor temp. (transp./ storage)	+ 80 °C
Min. permissible ambient motor temp. (transp./storage)	- 40 °C
Mounting position	Shaft horizontal or rotor on bottom; rotor on top on request
Condensate discharge holes	Rotor-side
Operation mode	S1
Motor bearing	Ball bearing
Touch current acc. IEC 60990 (measuring network Fig. 4, TN system)	< 0.75 mA
Motor protection	Thermal overload protector (TOP) wired internally
Cable exit	Variable
Protection class	I (if protective earth is connected by customer)
Product conforming to standard	EN 60335-1; CE
Approval	CCC

AC axial fan


sickled blades (S series)
with full round nozzle

Product drawing

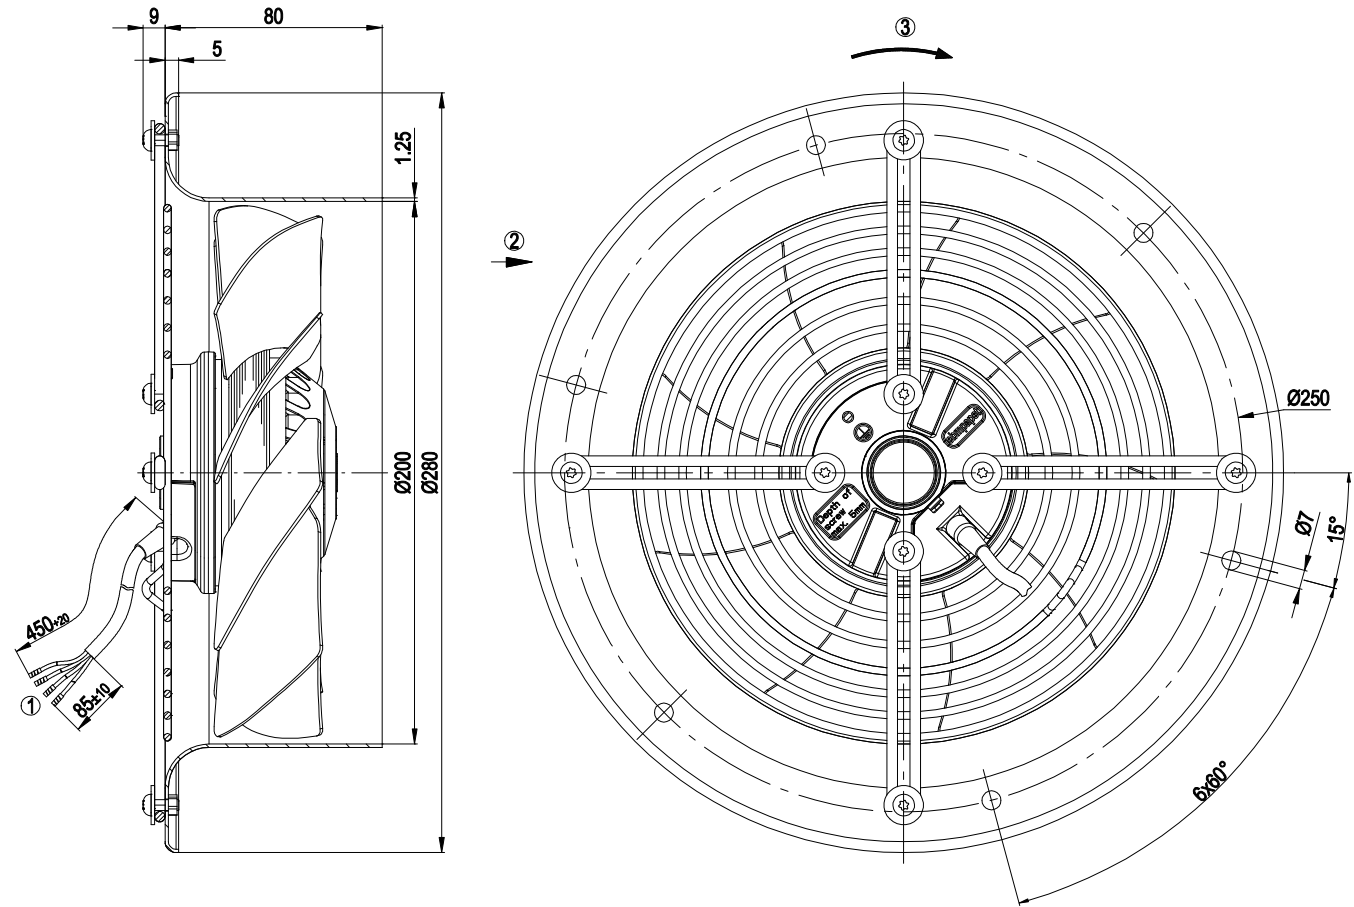

- | | |
|---|---|
| 1 | Connection line PVC, 4x crimped core-end sleeves |
| 2 | Direction of air flow "A" |
| 3 | Direction of rotation counterclockwise, seen on rotor |

Connection screen

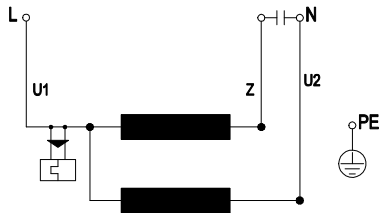


U1	blue	Z	brown	U2	black
PE	green/yellow				



AC axial fan

sickled blades (S series)
with full round nozzle

Charts: Air flow 50 Hz

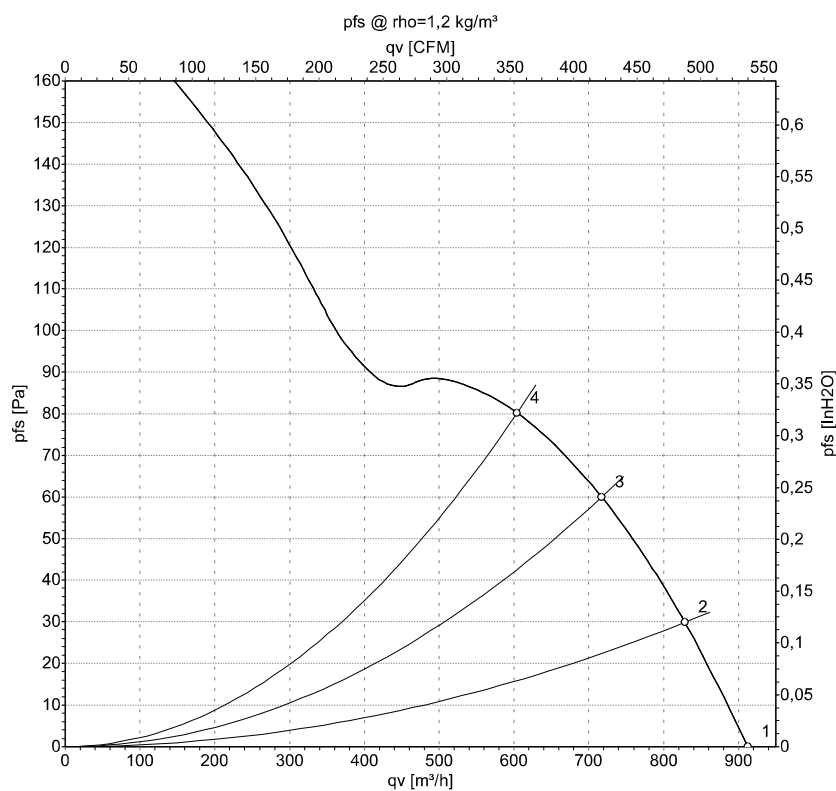

Measurement: LU-26449

Air performance measured as per ISO 5801
Installation category A. For detailed
information on the measuring set-up, please
contact ebm-papst. Suction-side noise
levels: LwA measured as per ISO 13347 /
LpA measured with 1m distance to fan axis.
The values given are valid under the
measuring conditions mentioned above and
may vary according to the actual installation
situation. With any deviation from the
standard set-up, the specific values have to
be checked and reviewed with the unit
installed.

Measured values

	U	f	n	P _e	I	qv	p _{fs}
	V	Hz	min ⁻¹	W	A	m³/h	Pa
1	230	50	2600	64	0.30	915	0
2	230	50	2560	66	0.30	830	30
3	230	50	2505	69	0.31	715	60
4	230	50	2465	70	0.32	605	80


U = Supply voltage · f = Frequency · n = Speed · P_e = Power input · I = Current draw · qv = Air flow · p_{fs} = Pressure increase



AC axial fan

sickled blades (S series)
with full round nozzle

Charts: Air flow 60 Hz

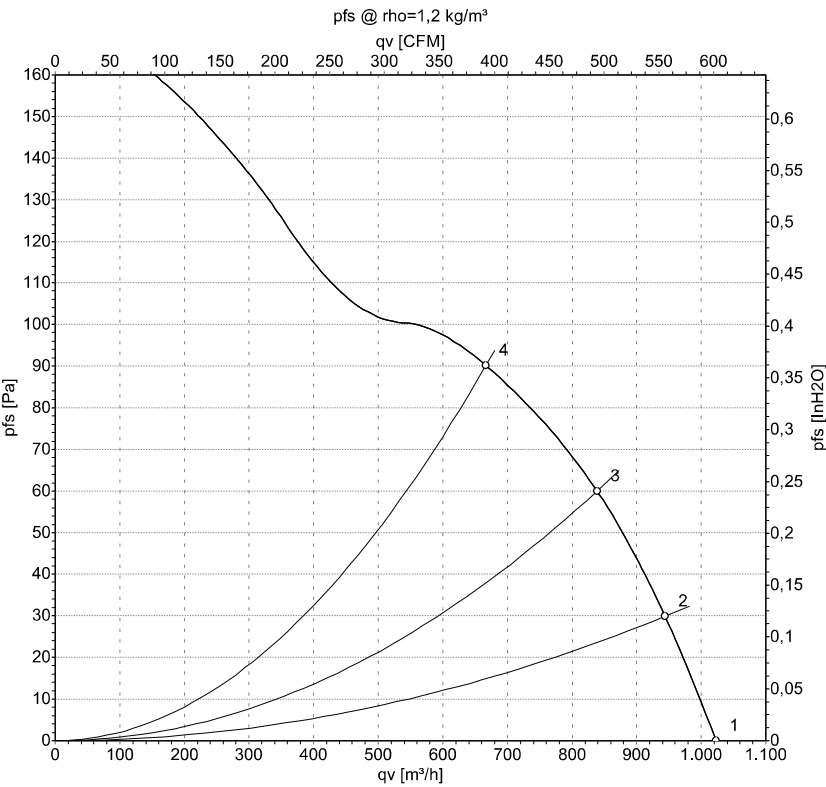

Measurement: LU-26450

Air performance measured as per ISO 5801
Installation category A. For detailed
information on the measuring set-up, please
contact ebm-papst. Suction-side noise
levels: LwA measured as per ISO 13347 /
LpA measured with 1m distance to fan axis.
The values given are valid under the
measuring conditions mentioned above and
may vary according to the actual installation
situation. With any deviation from the
standard set-up, the specific values have to
be checked and reviewed with the unit
installed.

Measured values

	U	f	n	P _e	I	qv	p _{fs}
	V	Hz	min ⁻¹	W	A	m³/h	Pa
1	230	60	2900	78	0.34	1025	0
2	230	60	2850	80	0.34	945	30
3	230	60	2750	84	0.36	840	60
4	230	60	2670	86	0.37	665	90

U = Supply voltage · f = Frequency · n = Speed · P_e = Power input · I = Current draw · qv = Air flow · p_{fs} = Pressure increase

